


FRONT WHEEL/SUSPENSION/STEERING

BUSHING/BACK-UP RING

Visually inspect the slider and fork tube bushing. Replace the bushing if there is excessive scoring or scratching, or if the teflon is worn so that the copper surface appears on more than 3/4 of the entire surface.

Check the back-up ring at the points shown. Replace if there is any distortion at the points shown.

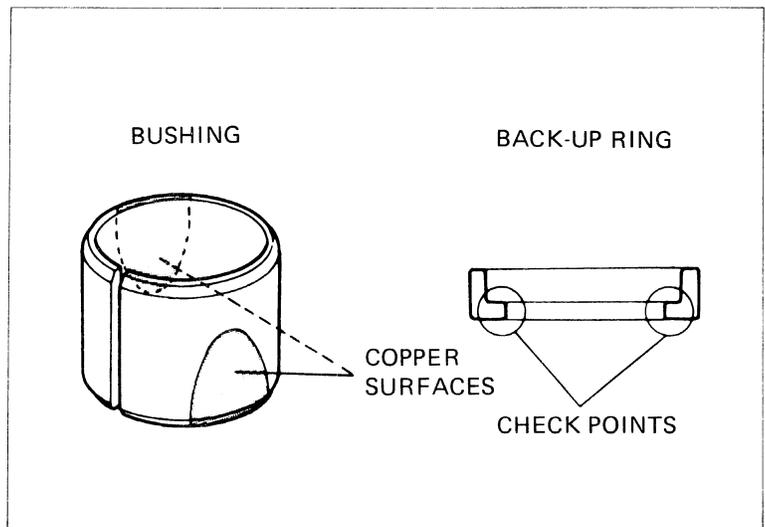

ASSEMBLY

NOTE

Wash all removed parts in solvent and wipe them off thoroughly before assembly.

